




# Air quality AQ 100

New

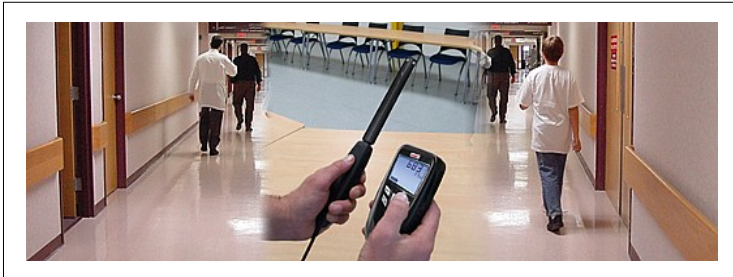


## Functions

- CO<sub>2</sub> measurement and ambient temperature
- Selection of units
- Minimum and maximum values
- HOLD function
- Adjustable automatic shut-off
- Adjustable backlight

## Technical features

Measuring element.....	CO <sub>2</sub> : Infrared sensor. (Non dispersive- infrared sensor NDIR)
	<b>Ambient temperature</b> : Pt100 class A
Display.....	2 lines, LCD technology. Sizes 50 x 34.9 mm. 1 line of 5 digits with 7 segments (value) 1 line of 5 digits with 16 segments (unit)
Housing.....	Shock-proof made of ABS, IP54 protection
Keypad.....	Metal-coated with 5 keys
Cable.....	retractable, length 450 mm, up to 2.4 m when released
Conformity.....	electromagnetical compatibility (NF EN 61326-1 guideline)
Power supply.....	1 alcaline battery 9V 6LR61
Operating temperature.....	from 0 to 50°C
Storage temperature.....	from -20 to +80°C
Auto shut-off.....	adjustable from 0 to 120 min
Weight.....	190g
Languages.....	French, english

A Q 1 0 0 - CO<sub>2</sub> /temperature probe -

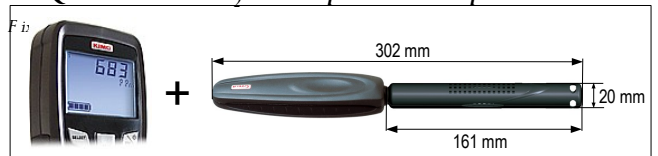

## Specifications


	Measuring units	Measuring ranges	Accuracy*	Resolutions
<b>CO<sub>2</sub></b>				
	ppm	From 0 to 5000 ppm	±3 % of reading ±50 ppm**	1 ppm
<b>AMBIENT TEMPERATURE</b>				
	°C, °F	from -20 to +80°C	±0.4% of reading ±0.3°C	0.1°C

\*All accuracies indicated in this document were stated in laboratory conditions and can be guaranteed for measurements carried out in the same conditions, or carried out with required compensation.  
 \*\*the accuracy is expressed either by a deviation in ppm, or by a percentage of the value concerned. Only the bigger value is considered.


## Working principle

### NDIR - Non dispersive infrared absorbance

A gas absorbs light at a specific wavelength, some of the intensity emitted by the infrared source is absorbed by the gas sample. The amount of light read by the IR sensor is inversely proportional to CO<sub>2</sub> concentration.

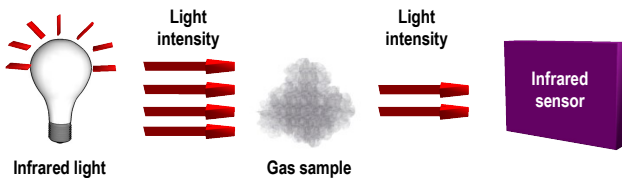

## Dimensions

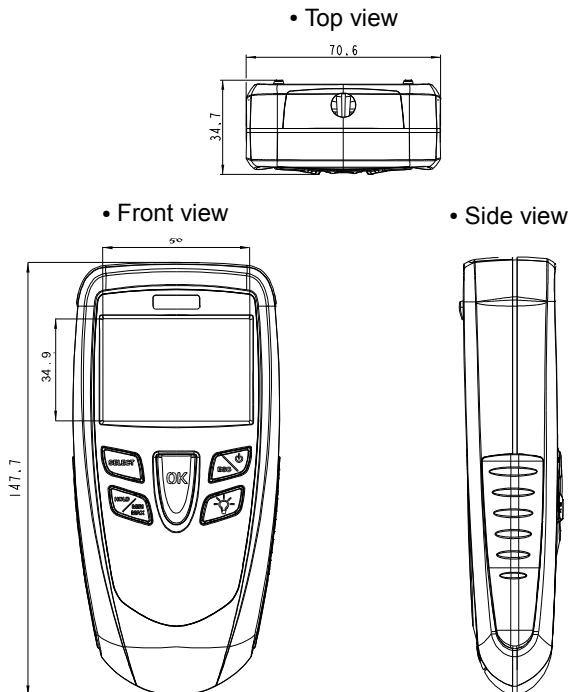

## Supplied with ...

DESCRIPTION	AQ 100
Calibration certificate*	●
Transport case	●

● Included ○ Optional

\*except class 102S



## Accessories (See related datasheet)

CE 100	RTS
Protective cover with magnet and holding system	Telescopic extension (for probe), 1m long and bent at 90°.

## Warranty period

Instruments have 1-year guarantee for any manufacturing defect (return to our After-Sales Service required for appraisal).

F Tang – AQ100 – 10/08 C – We reserve the right to modify the characteristics of our products without notice.